

GSTIN NO : 04AEOPP2926E1ZJ

COL T S PLAHA  
FIV, FIE (INDIA)  
BE (CIVIL) ME (STRUCTURES)  
PGD IN B& IM and Eco & Env  
CERTIFICATE IN SOLAR ENERGY  
CHARTERED ENGINEER(I)  
Addl. Chief Engr. (retd)  
Registered & Govt. Approved Valuer  
Regd No .CC/CHD/TECH/II/Valuer/170  
U/S-34 Ab of Wealth Tax Act –Teg  
PROP TARA CONSTRUCTION CO

KOTHI NO :30  
PHASE-9, MOHALI (PB)-160062  
PHONE :0172-5058027  
MOBILE; 9814166507  
9814388507,9417266507,  
9056566507.  
E-mail : colplaha7@gmail.com  
colplaha@hotmail.com  
Office :2553, Sector 47- c,  
Chandigarh -160047

**To Whom It May Concern**

Having been engaged for issuing the certificate for the Safety & Security of School buildings, I have visited the school premises of Primary School and Hr Sec School of Sec 47, Chandigarh along with the Prtincipal on 17 Apr, 2021. I am of the opinion that the Double storeyed buildings of Primary School and Triple Storeyed building of Hr Sec School are **structurally sound and are safe**. The TRS Huts in Hr Sec School in L Block are quite old have outlived their shelf life however these can be used for running the classes . These should be maintained properly & be got repaired at the earliest under the Head "Special Repairs".

2. The TRS Hut near the Main Entrance Gate have developed diagonal Cracks as shown in the photographs. These Diagonal cracks have developed because of the settlement of foundation in the rear wall of the building . The settlement has ocured probably due to water logging in the area as there is no proper drainage and water has seeped into the foundation. The immediate remedial measure is to construct Plinth Protection walls and Buttress walls along the rear wall opposite to the partition walls of the rooms to protect the building from further deterioration . The class rooms numbered 19 to 24 in the building has been locked by the Principal for safety of the children till suchtime the remedial measures are not completed.

3. Secondly the School premises of Primary & Higher Secondary School s have been provided with boundary wall with gate all around and are well secured, The boundary wall of the school are recommended to be provided with Barbed wire fencing with concertina coils on top . The photographs of the school buildings are attached.

4. The case may please be initiated through proper channel and recommendation of local counsellor for allotment of funds for carrying out special repairs through Chief Engr UT Admn

Place : Chandigarh/ Mohali

Dated: 15 Apr, 2021



Col TS Plaha ( Retd )

Govt Approved Valuer &

Structural Engineer

**Col T S PLAHA**  
FIV, FIE (I) Ch (I), MICA  
STRUCTURAL ENGR.  
& CHARTERED ENGR.

**Col T S PLAHA**  
FIV, FIE (I) Ch (I), MICA  
REGISTERED VALUER  
CC/Chd/Tech-II/Valuer/170